



Technical Bulletin – TBN-009

Product: LCV1 Toyota Landcruiser 78/79 series.

Subject: Small Backup Ring Added to EMMA Piston.

Summary:

24-2010 PISTON EMMA

Has had an increase in the width of the smaller o-ring groove in order to fit:


01-4051 BACKUP RING EMMA SMALL

Description:

EMMA pistons produced after 01/05/05 have had the width of the groove for the small o-ring increased from 4.80mm to 5.30mm. This is to allow the inclusion of a Teflon backup ring alongside the small o-ring.

A photo of the new configuration is shown overleaf.

Customers with brakes made before 01/05/05 who order replacement EMMA pistons (Part Number 24-2010) should also order small backup rings (Part Number 01-4051) for installation with the new pistons. If a new type piston is installed without the small backup ring, the service life of the small o-ring may be reduced.

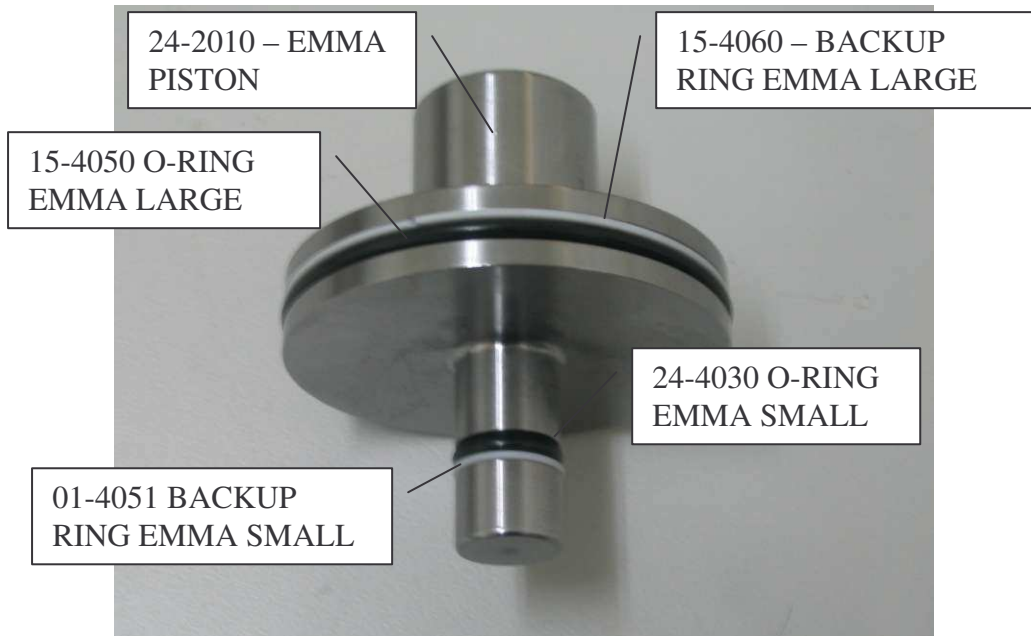

Prepared by: Jasper Stewart
Issue Date: 06/07/2005
Issue Revision: 1

Safe Effect Pty. Ltd.
Unit 3/75 Erindale Rd
Balcatta WA 6021
AUSTRALIA
PO Box 632
Balcatta WA 6914

Tel: +61(08) 9240 2713
Fax: +61 (08) 9240 1577
Email: info.perth@safeffect.com
Web: www.safeffect.com